




Basevan.com General Inspection

Inspection details

Name of inspector	Wallis
Date of inspection	10/12/2024
Signature	

Vehicle details

Vehicle registration	R713GMW
Vehicle chassis no.	WDB6683532N065724
Miles (if in km, multiply by 0.62)	66,377
Make	Mercedes
Model	Vario
Transmission	Manual, 5 speed
Factory immobiliser installed	Yes
Speed limiter installed	Yes
Drive configuration	RWD
Gross Vehicle Weight (kg)	5990
Towing capacity	3000
Tow bar installed	No

Off side front

Age (month/year) Manufactured	36/21
Make, brand.	Other (comment)
Tyre size	215/75/R16
Pressure 1	50
Pressure 2	
Wearing / Perishing (inner)	none
Wearing / Perishing (outer)	None
tread depth (mm)	10
General comments	Avon



Basevan.com General Inspection

Images of tyre




Near side front

Age (month/year) Manufactured	50/21
Make, brand.	Other (comment)
Tyre size	215/75/R16
Pressure 1	50
Pressure 2	
Wearing / Perishing (inner)	none
Wearing / Perishing (outer)	None
tread depth (mm)	10
General comments	Avon



Basevan.com General Inspection

Images of tyre

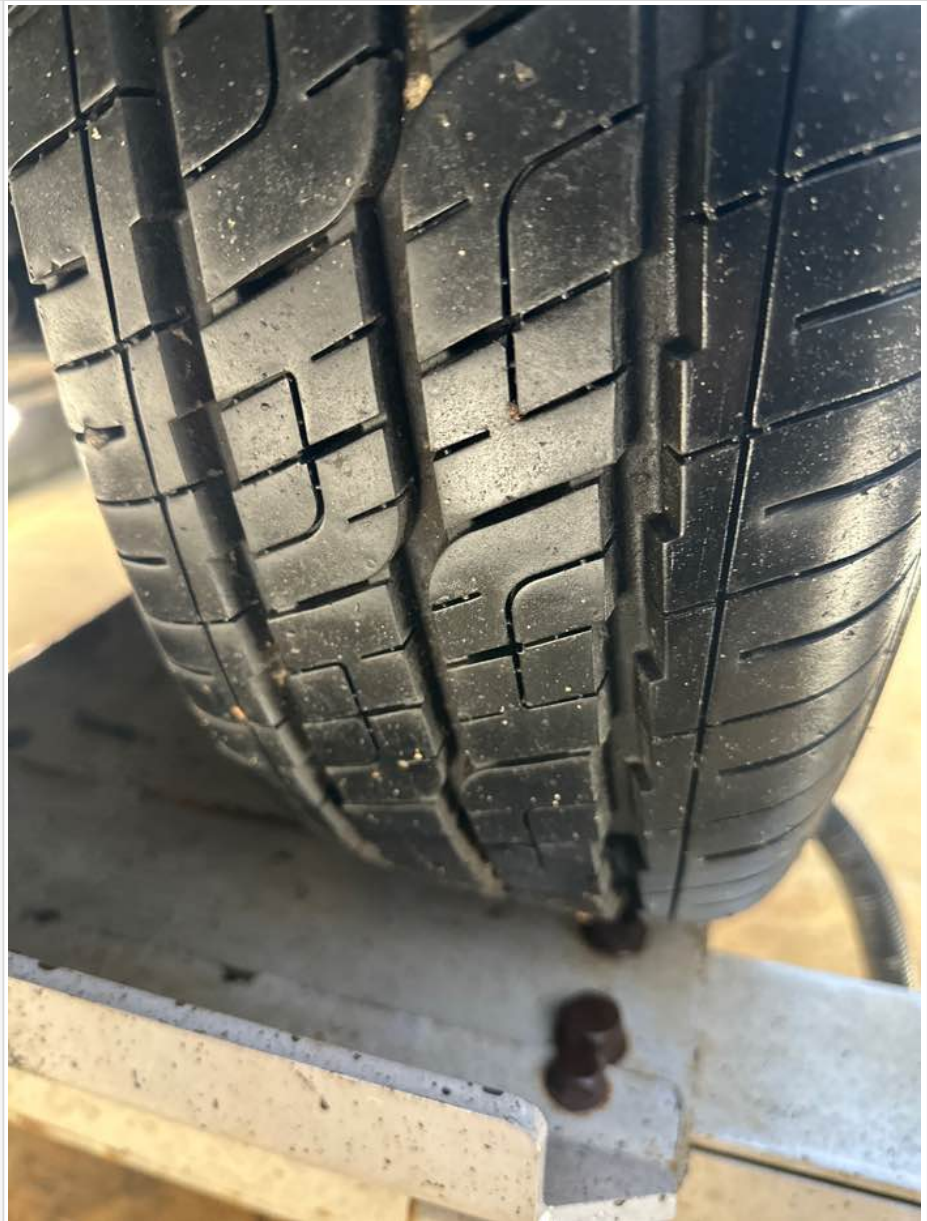

near side rear

Age (month/year) Manufactured	06/12
Make, brand.	Good Year
Tyre size	215/75/R16
Pressure 1	50
Pressure 2	
Wearing / Perishing (inner)	Medium
Wearing / Perishing (outer)	Medium
tread depth (mm)	5
General comments	



Basevan.com General Inspection

Images of tyre

Off side rear

Age (month/year) Manufactured	24/12
Make, brand.	GT Radial
Tyre size	215/75/R16
Pressure 1	49
Pressure 2	
Wearing / Perishing (inner)	Medium
Wearing / Perishing (outer)	Medium
tread depth (mm)	5
General comments	



Basevan.com General Inspection

Images of tyre




off side Inner (for twin wheel vans)

Is the vehicle a twin wheel axle? (if no don't fill out)	Yes
Age (month/year) Manufactured	42/12
Make, brand.	Budget
Tyre size	215/75/R16
Pressure 1	50
Pressure 2	
Wearing / Perishing (inner)	Slight
Wearing / Perishing (outer)	Slight



Basevan.com General Inspection

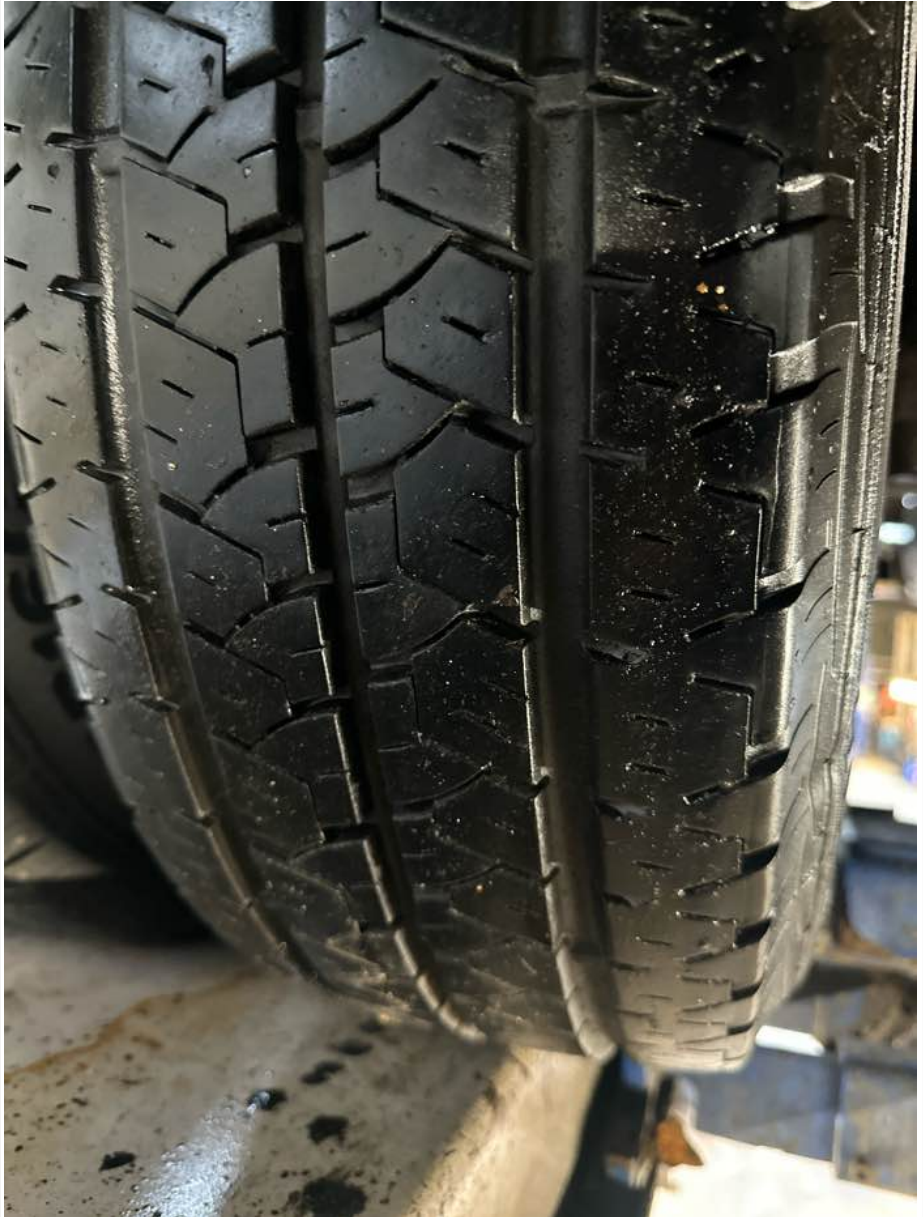
tread depth (mm)	8
General comments	
Images of tyre	

near side Inner (for twin wheel vans)

Is the vehicle a twin wheel axle? (if no don't fill out)	Yes
Age (month/year) Manufactured	16/10
Make, brand.	Budget
Tyre size	215/75/R16
Pressure 1	45
Pressure 2	



Basevan.com General Inspection


Wearing / Perishing (inner)	Medium
Wearing / Perishing (outer)	Medium
tread depth (mm)	6
General comments	
Images of tyre	

Spare wheel

Spare installed? (If no, don't fill out)	Yes
Age (month/year) Manufactured	
Make, brand.	Budget
Tyre size	215/75/R16



Basevan.com General Inspection


Pressure 1	30
Pressure 2	
Wearing / Perishing (inner)	none
Wearing / Perishing (outer)	None
tread depth (mm)	10
General comments	
Images of tyre	

Vehicle locking

Factory central locking fitted?	No
Response from key fob?	N/A



Basevan.com General Inspection

Response from in-cab locking button?	N/A
Do all the doors lock from central locking function?	None
Select the following doors that lock.	N/S Front, O/S Front, N/S Rear, O/S Rear
Method of locking	Key
In conclusion can all the doors be locked in some way and thus the vehicle can be left unattended at night safely?	No
How many keys present at time of inspection?	
Comment	

In cab checks



Basevan.com General Inspection


Number of seats (cab only)	Driver & 2 passenger
Cab heater check	Works on all settings
Comment on cab heater	
Electric windows present	No
Cab windows function check	Driver side function, Passenger side function
Air conditioning present	No
Charging socket present (cigarette lighter)	Yes
Function working?	Yes
Radio / Media system fitted?	Yes
Radio / media system check	Functions
Reverse camera present?	No
Reverse camera functioning?	No
Show any damage or missing items	

General mechanical checks

Fuel level	1/2 Full
Oil level	Low
Oil conditon	Service due soon
Start up, chassis battery check	Started without jump pack
Start-up from cold	2 seconds
Exhaust smoke from cold	Normal
Output Voltage of Alternator test	14.1
Chain or Belt driven engine?	Chain
If belt any proof of change?	N/A
Coolant condition	Clean
Coolant level	Full
Anti-freeze temperature check	
Washer fluid	Full
Brake fluid	Medium
Power steering fluid	Maximum
Dashboard warning light	No warning lights
OBD Scan results	



Basevan.com General Inspection

<p>Engine bay photo</p>	
<p>Comment</p>	